

Technical Bulletin

MAYTAG®

Type Policy Letter
√ Service Information

Attention Service Managers
√ Service and Parts Managers

Models All Maytag built Side by Side Dispenser & Non Dispenser Models
1998 to Current.

Issue Hollow Ice and Clumping and Jamming of Ice.

Warranty Covered under terms of warranty issued with the product.

Action Air not being directed towards the Icemaker mold.
Install 12001952 Icemaker Air Tunnel (All Except Counter Depth Models)
Install 12001953 Icemaker Air Tunnel (Counter Depth Models)

Date: May 2002

No: TDR-0009-B
Page 1 of 4

Brand

Maytag
Magic Chef
Crosley
Admiral
Jenn-Air

Product

Refrigerator

See Attached Instruction Sheet 16021617:


Instruction Sheet

16021617

Description: Icemaker Air Tunnel Kit

Repair Part Number: 12001952 Dispenser & Non Models 1998 To Current
12001953 CD (Counter Depth) Models 1998 To Current


Kit includes: 61005812 Icemaker Air Tunnel (All Except CD)
61005813 Icemaker Air Tunnel CD (Counter Depth)

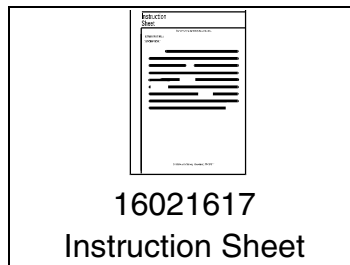

WARNING

To avoid risk of electrical shock, personal injury or death; disconnect electrical power before servicing

Procedure:

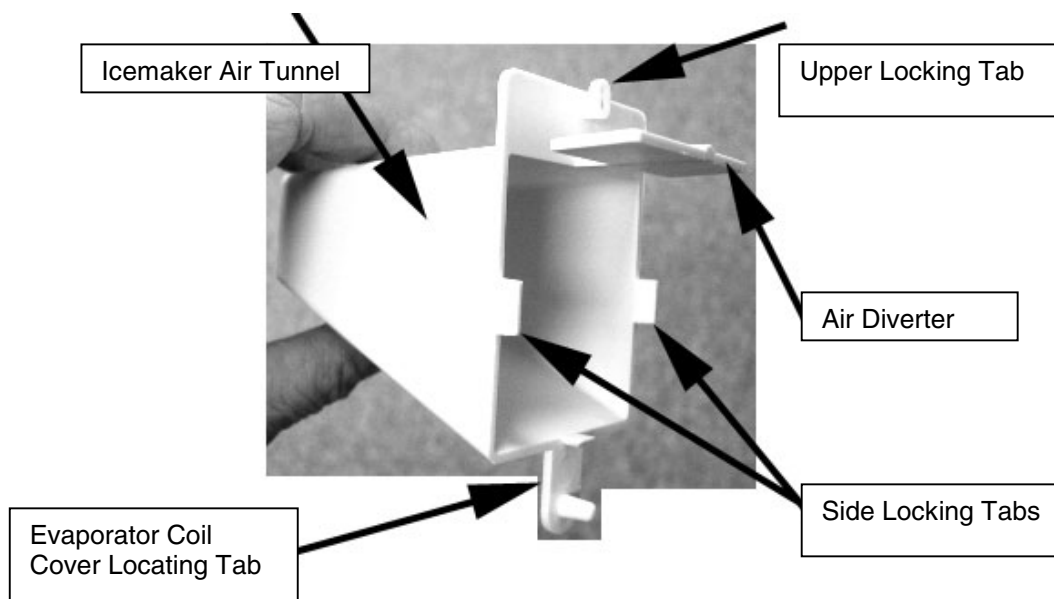

1. Remove the crusher bin assembly and the icemaker.

- Using your finger remove the icemaker air tunnel coil cover-locating tab (this is only used on current production models) See figure 1.

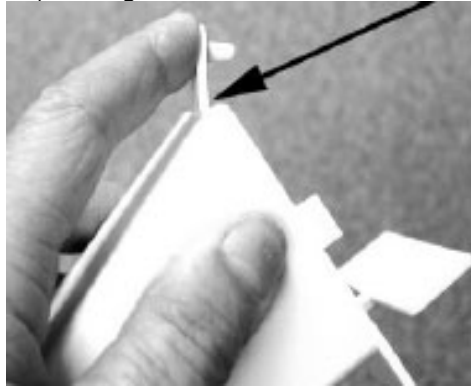


Figure 1

- Turn the icemaker air tunnel 90°. Insert the air diverter into the upper evaporator coil cover louvers, second row third slot in from the left. (See figure 2).

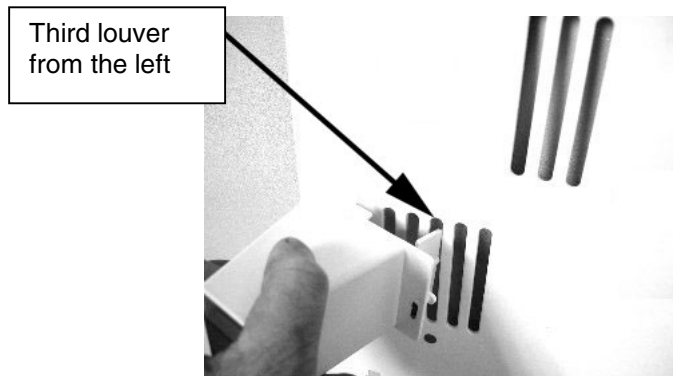


Figure 2

- Rotate the air tunnel counter clockwise 90°. Make sure the side and the upper locking tabs are locked in place behind the coil cover. (See figure 3)

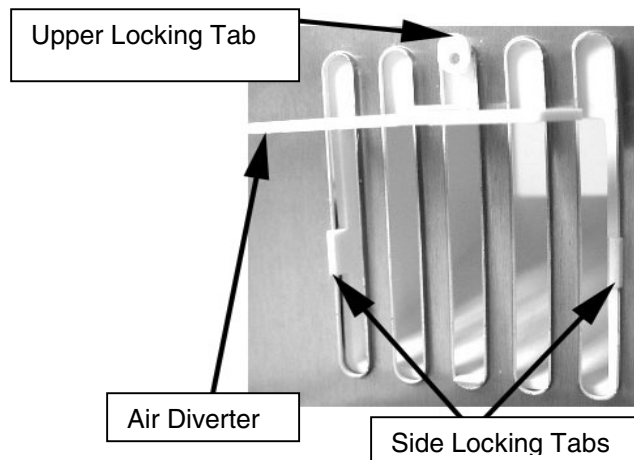


Figure 3

Note: Figure 3 is for reference only - you do not have to remove the evaporator coil cover.

5. Reinstall the icemaker and the crusher bin assembly. Make sure fill tube is in icemaker fill cup. Reconnect power source and make sure the arm is in the down (on) position.

